

Accessories – Potential supply

Cross-connectors for potential supply (cross-section reduction)

Power supply via

WDU 35

Outgoing terminal	WDU 2.5	WDU 4 / WDU 6	WDU 10	WDU 16
				
Technical data	to WDU 35	to WDU 35	to WDU 35	to WDU 35
Continuous current 2-pole	41	41	57	76
Thread size	M 4	M 4	M 4	M 4
Tightening torque	1.2 ... 1.8	1.2 ... 1.8	1.2 ... 1.8	1.2 ... 1.8
Order data	to WDU 2.5	to WDU 4 / 6	to WDU 10	to WDU 16
Type	WQV 35-2.5	WQV 35-4/6	WQV 35-10	WQV 16/2
Qty	10	10	10	50
Order No.	1064100000	1064200000	1068000000	1053260000

Power supply via

WDU 16

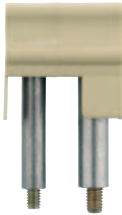
WDU 10

Outgoing terminal	WDU 2.5	WDU 4 / WDU 6	WDU 2.5	WDU 4
				
Technical data	to WDU 16	to WDU 16	to WDU 10	to WDU 10
Continuous current 2-pole	41	41	24	32
Thread size	M 4	M 4	M 3	M 3
Tightening torque	1.2 ... 1.8	1.2 ... 1.8	0.5 ... 0.8	0.5 ... 0.8
Order data	to WDU 2.5	to WDU 4 / 6	to WDU 2.5	to WDU 4
Type	WQV 16-2.5	WQV 16-4/6	QL 10-2.5	QL 10-4
Qty	10	10	10	10
Order No.	1063900000	1064000000	185962000	1859610000
			not finger-safe	not finger-safe

Power supply via

WDU 16N

WDU 6

Outgoing terminal	WDU 2.5	WDU 4 / WDU 6	WDU 10	WDU 2.5
				
Technical data	to WDU 16	to WDU 16N	to WDU 16N	to WDU 6
Continuous current 2-pole	24	41	24	24
Thread size	M 3	M 3	M 3	M 3
Tightening torque	0.5 ... 0.8	0.5 ... 0.8	0.5 ... 0.8	0.5 ... 0.8
Order data	to WDU 2.5	to WDU 4 / 6	to WDU 10	to WDU 2.5
Type	WQV 16N-2.5	WQV 16N-4/6	WQV 16N-10	QL 6-2.5
Qty	10	10	10	10
Order No.	1073100000	1072500000	1073400000	1859600000
				not finger-safe

Articles with coloured order number are kept permanently in stock at the central warehouse in Germany.
Delivery times see page X.2